

INDEPENDENT BATTERY CERTIFICATE



CERTIFICATE NUMBER: 5B748DAD-0942-4D73-8F0A-114FBC33341F

VEHICLE

BRAND: Dacia
MODEL: Spring Electric - 27,4 kWh

MILEAGE: 36,981 km
VIN: UU1DBG005NU087378
DATE AND TIME:
06/05/2026, 11:11

EXECUTED BY: AAA Auto

RESULTS

Independent
STATE OF HEALTH (SOH)


92.5 %



RATING

BENCHMARKING

How does your vehicle compare to comparable vehicles?

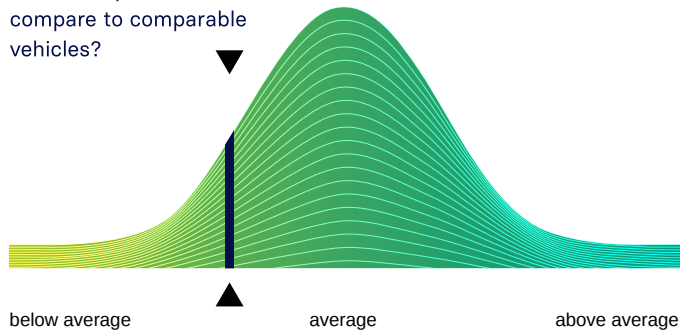

CHECKS

- Battery Management System (BMS) ✓
- Battery Sensor ✓
- Battery Measurements ✓
- Battery Cell Voltages ✓
- Vehicle Communication ✓



SCAN FOR DETAILS

EVALUATION

GOOD HEALTH - NO ABNORMALITIES DETECTED

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in good condition.

The drive battery is therefore officially AVILOO Certified.

Dr. Marcus Berger, CEO



ENERGY

	Gross	Net (Nominal)	Usable
Current:	25.3kWh	24.8kWh	22.8kWh
New:	27.4kWh	26.8kWh	24.7kWh

RANGE

	WLTP	Typical	Individual
Current:	203-213km	164km	177km
New:	220-230km	177km	191km

EXECUTION PROTOCOL

AVILOO Box connected.	11:11:34
FLASH Test started.	✓
Vehicle detected.	✓
Starting data acquisition.	✓
Finished data acquisition.	✓
Analyzing data.	✓
Analysis completed.	✓

SENSORS

Voltage Sensor	✓
Current Sensor	✓
Temperature Sensors	✓
Cell Voltage Sensors	✓

BMS


	Value	Status
BMS State of Charge (SoC)*:	98%	
SoC calculation accuracy:		✓
BMS State of Health (SoH)*:	92%	
SoH calculation accuracy:		✓

MEASUREMENTS

	Min	Max	Delta	Status
Battery Temperature	20.0°C	20.4°C	0.4°C	✓
Cell Voltage	4.191V	4.196V	5mV	✓
Pack Voltage	302.0V			
Average Current	-1.0A			

CELL VOLTAGES DIAGRAM

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
1 - 20	4.196	4.194	4.196	4.194	4.194	4.196	4.194	4.194	4.196	4.194	4.196	4.196	4.194	4.196	4.196	4.194	4.194	4.194	4.191	4.194
21 - 40	4.194	4.196	4.194	4.194	4.194	4.194	4.196	4.194	4.194	4.196	4.194	4.194	4.194	4.194	4.196	4.194	4.194	4.194	4.196	4.194
41 - 60	4.194	4.194	4.194	4.194	4.194	4.194	4.194	4.194	4.191	4.194	4.194	4.194	4.194	4.196	4.194	4.194	4.194	4.194	4.196	4.194
61 - 72	4.194	4.194	4.194	4.194	4.194	4.194	4.191	4.194	4.194	4.194	4.191	4.194	/	/	/	/	/	/	/	/

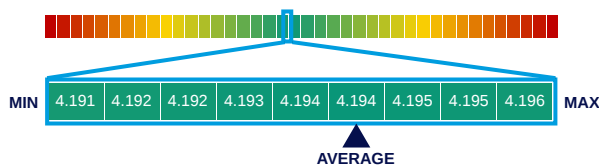

*The values shown here were read directly from the vehicle's battery management system (BMS) and are calculated and provided by the vehicle manufacturer. The State of Health (SoH) displayed corresponds to the value reported by the BMS and is CARA-certified.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOO's algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the SoH of the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Management System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.